PAGE: 1

PRINT DATE: 08/20/97

FAILURE MODES EFFECTS ANALYSIS (FMEA) - NON-CIL HARDWARE

NUMBER: 05-688-2270 -X

SUBSYSTEM NAME: EPO&C - BRAKE/ANTI SKID

REVISION: 1

08/20/97

PART DATA

PART NAME

VENDOR NAME

PART NUMBER

VENDOR NUMBER

LRU

: RESISTOR ASSEMBLY

VO70-763430

SRU

: RESISTOR, ANTI-SKID VALVE

RWR80S1R00FR

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

RESISTOR, ANTI-SKID VALVE COIL CURRENT MEASUREMENT (1 OHM, 2 W)

REFERENCE DESIGNATORS:

40V51A1R1

40V51A1R2 40V51A2R1

40V51A2R1

QUANTITY OF LIKE ITEMS: 4

ONE PER RIGHT HAND BRAKE SEGMENT, FOUR PER VEHICLE

FUNCTION:

6. 18 PROVIDES MEANS TO MEASURE ANTI-SKID CURRENT (RIGHT HAND SIDE ONLY)

PAGE 2 PRINT DATE: 08/20/97

I FAILURE MODES EFFECTS ANALYSIS FMEA - NON-CIL FAILURE MODE

NUMBER: 05-6BB-2270+01

REVISION#:

1

08/20/97

SUBSYSTEM NAME: EPD&C - BRAKE/ANTI SKID

LRU: FWD LCA 1 1TEM NAME: RESISTOR, ANTI-SKID VALVE **CRITICALITY OF THIS**

FAILURE MODE: 1R3

FAILURE MODE:

FAILS OPEN

MISSION PHASE:

DO DE-ORBIT

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

103 DISCOVERY

CAUSE:

STRUCTURAL FAILURE, MECHANICAL STRESS, VIBRATION, ELECTRICAL STRESS.

THERMAL STRESS, PROCESSING ANOMALY

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) PASS

B) PASS

C) PASS

PASS/FAIL RATIONALE:

A)

B)

Ç)

- FAILURE EFFECTS -

(A) SUBSYSTEM:

FIRST FAILURE - LOSS OF SKID AND LOCKED WHEEL PROTECTION ON HALF OF ONE BRAKE.

(B) INTERFACING SUBSYSTEM(S):

FIRST FAILURE - LOSS OF SKID AND LOCKED WHEEL PROTECTION ON HALF OF ONE

BRAKE.

\$ W

PAGE: 3

FAILURE MODES EFFECTS ANALYSIS (FMEA) - NON-CIL FAILURE MODE NUMBER: 05-688-2270- 01

PRINT DATE: 08/20/97

(C) MISSION:

FIRST FAILURE - NO EFFECT.

(D) CREW, VEHICLE, AND ELEMENT(S):

FIRST FAILURE - LOSS OF SKID AND LOCKED WHEEL PROTECTION ON HALF OF ONE BRAKE.

(E) FUNCTIONAL CRITICALITY EFFECTS:

POSSIBLE LOSS OF CREW/VEHICLE AFTER THREE FAILURES:

- RESISTORS FAILS OPEN LOSS OF SKID AND LOCKED WHEEL PROTECTION ON HALF OF ONE BRAKE.
- 2) BRAKE ISOLATION VALVE OPENS PREMATURELY.
- UNCOMMANDED BRAKE PRESSURE BEFORE MAIN WHEELS TOUCHDOWN CAUSING TIRE/WHEEL FAILURE (ON THE AFFECTED SIDE) AND UNCONTROLLABLE YAWING FORCE.

-DISPOSITION RATIONALE-

(A) DESIGN:

REFER TO APPENDIX E, ITEM NO. 3 - RESISTOR, WIRE WOUND

(B) TEST:

REFER TO APPENDIX E, ITEM NO. 3 - RESISTOR, WIRE WOUND

GROUND TURNAROUND TEST

ANY TURNAROUND CHECKOUT TESTING IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

(C) INSPECTION:

REFER TO APPENDIX E, ITEM NO. 3 - RESISTOR, WIRE WOUND

(D) FAILURE HISTORY:

CURRENT DATA ON TEST FAILURES, FLIGHT FAILURES, UNEXPLAINED ANOMALIES, AND OTHER FAILURES EXPERIENCED DURING GROUND PROCESSING ACTIVITY CAN BE FOUND IN THE PRACA DATA BASE.

(E) OPERATIONAL USE:

NONE

PAGE: 4 PRINT DATE: 08/20/97

FAILURE MODES EFFECTS ANALYSIS (FMEA) - NON-CIL FAILURE MODE NUMBER: 05-6BB-2270-01

- APPROVALS -

EDITORIALLY APPROVED

: BNA : JSC

EDITORIALLY APPROVED TECHNICAL APPROVAL

ः १ : VIA APPROVAL FORM

J. Kimura B/20/97

dam Beney 9/24/97

96-CIL-011 05-68B